


Attachment 1 – Pictures of Inspection Findings

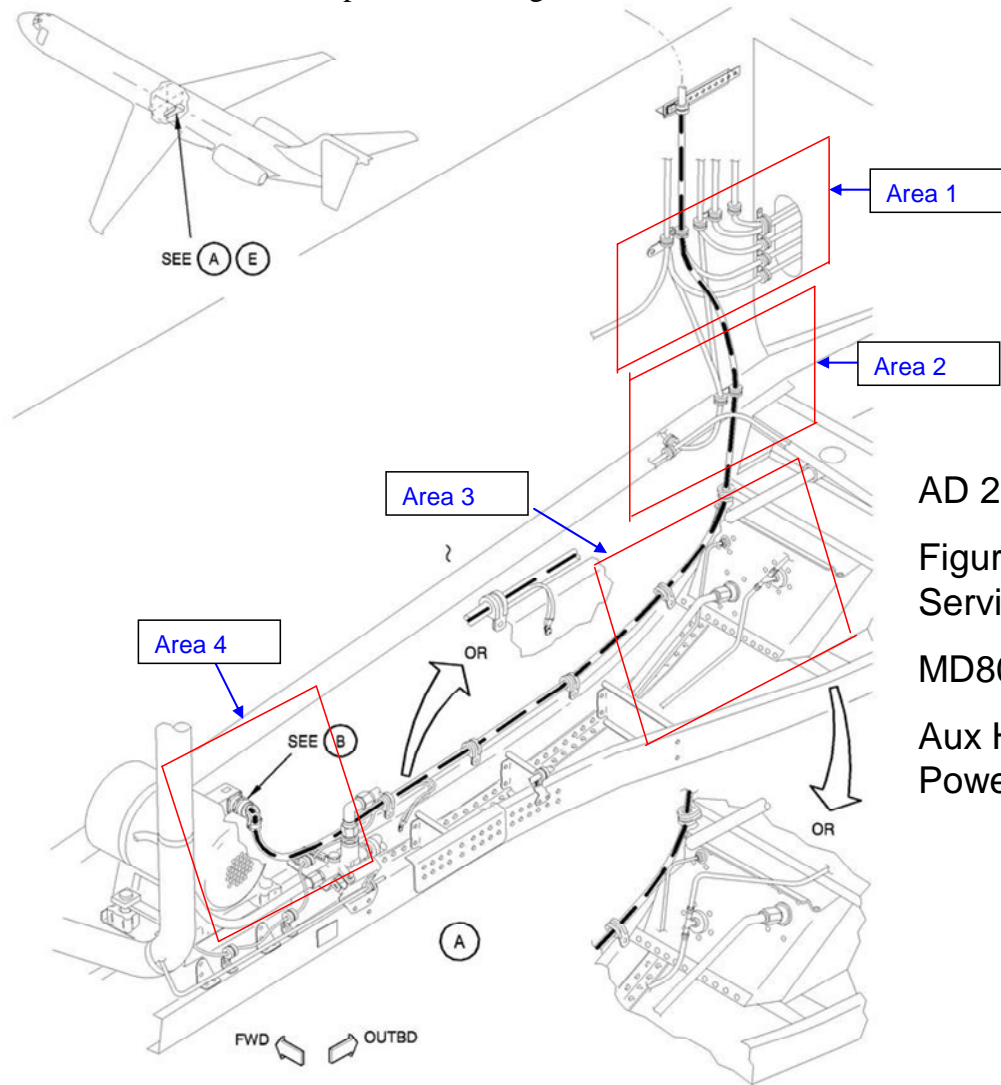

Areas with findings
are noted


AD 2006-15-15

Figure 1 of MD80 Alert
Service Bulletin

MD80-29A070 Rev 2


Aux Hydraulic Pump
Power Cable Route

Attachment 1 – Pictures of Inspection Findings: Area 1

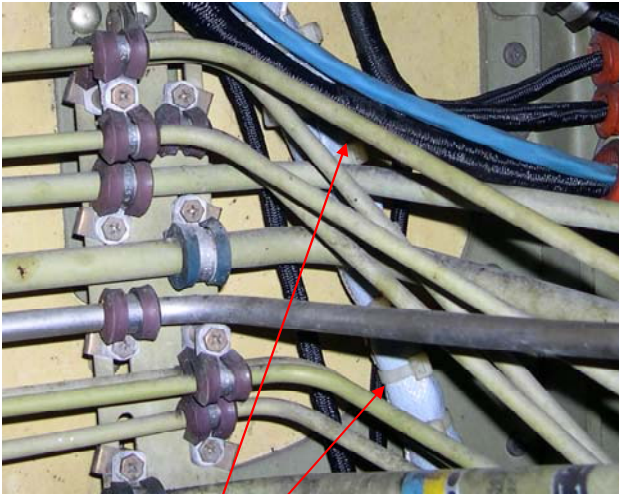


Incorrect - Use of Nylon Tie Wraps

**Correct – Use of tie tape
DMS 2089 per Service
Bulletin**

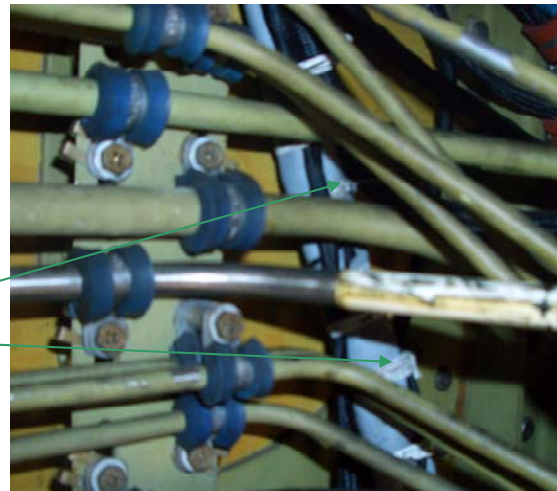

Area 1

Attachment 1 – Pictures of Inspection Findings: Area 1

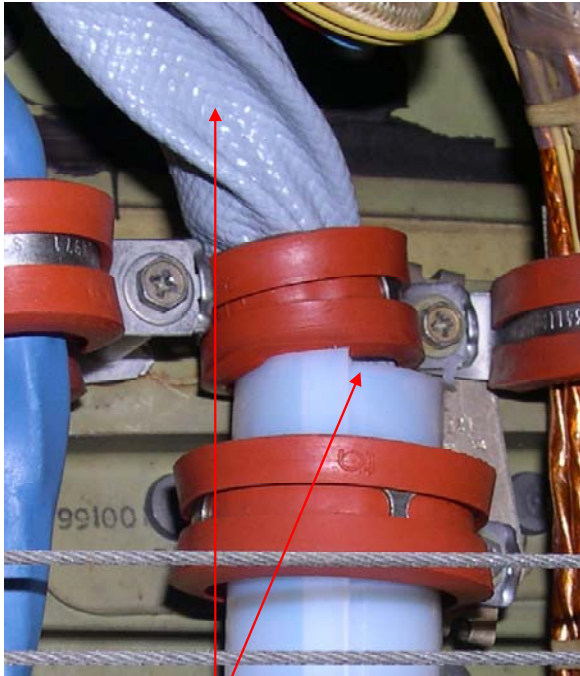

Incorrect – Snap tube installed too long. No tie tape used

Correct – Snap tube installed per Service Bulletin with tie tape

Area 1

Top of Snap Tube



Attachment 1 – Pictures of Inspection Findings: Area 2




Incorrect – Clamp not secured

Correct – Clamps secured to mount



Area 2

Attachment 1 – Pictures of Inspection Findings: Area 2

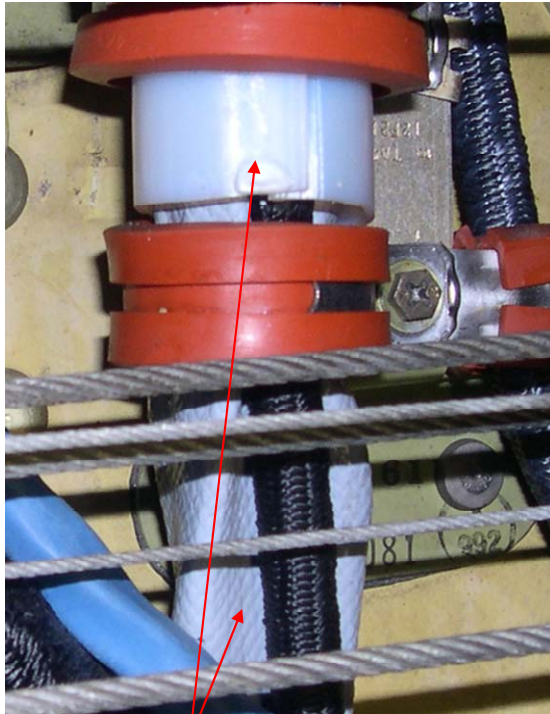


Incorrect – Snap tube too Long and no tie tape


Correct – Snap tube installed per Service Bulletin with tie tape

Area 2

Bottom of Snap Tube

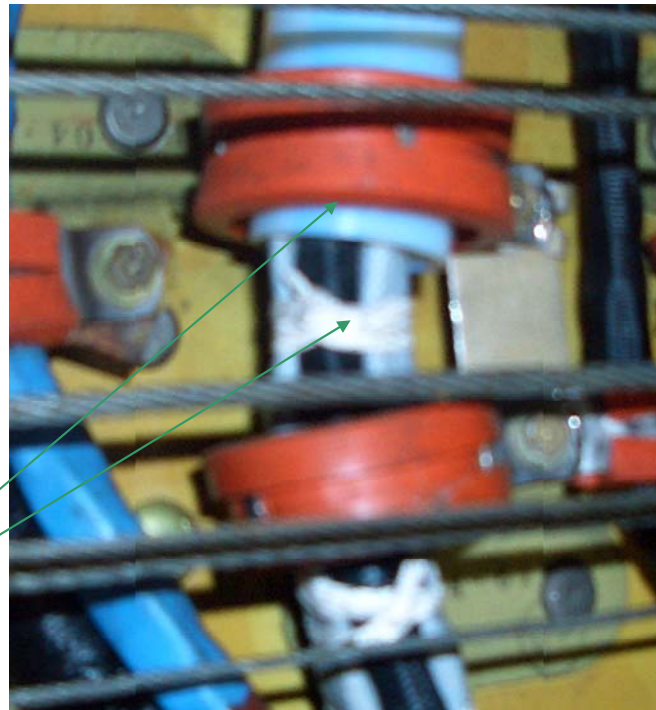

Attachment 1 – Pictures of Inspection Findings: Area 2

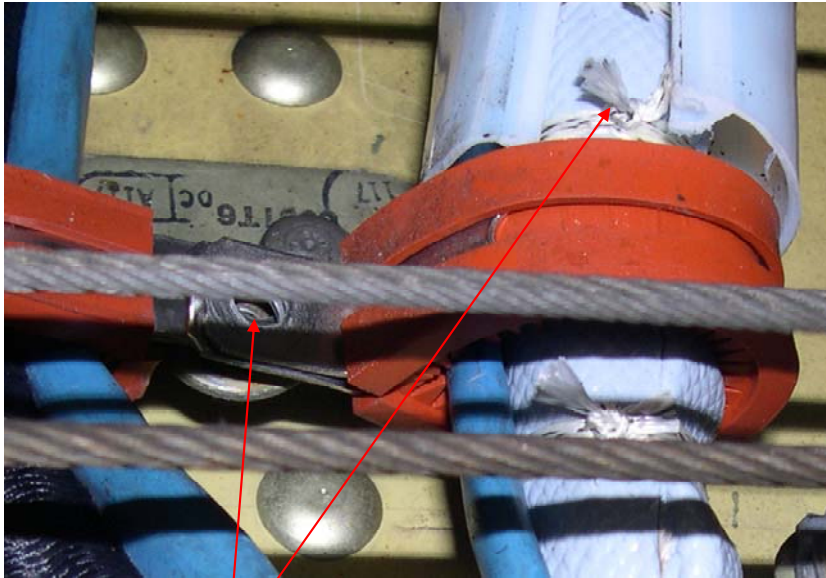

Incorrect – Clamp not installed and snap tube open and not installed in clamp

Correct – Installed correctly per Service Bulletin



Area 2


Attachment 1 – Pictures of Inspection Findings: Area 3




Incorrect – No tie tape installed

Correct – installed tie tape per Service Bulletin

Area 3

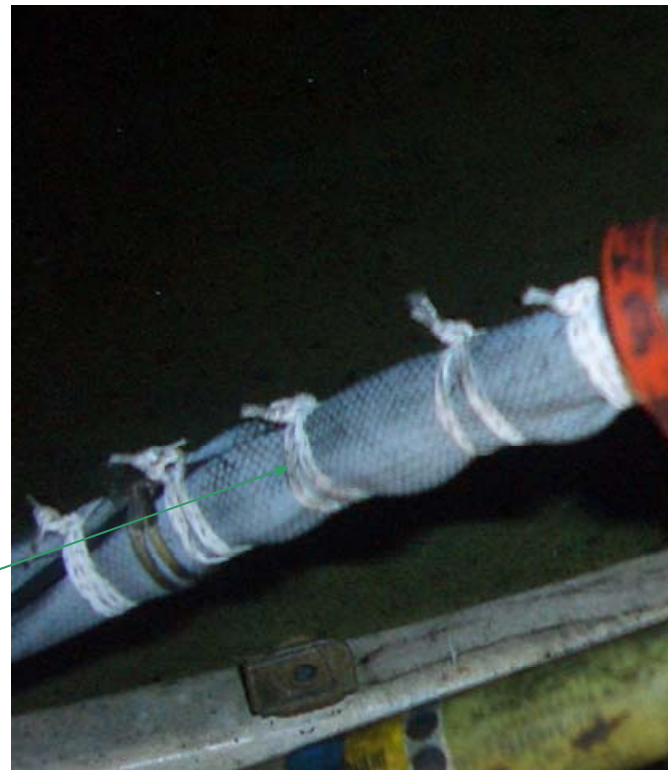

Attachment 1 – Pictures of Inspection Findings: Area 4

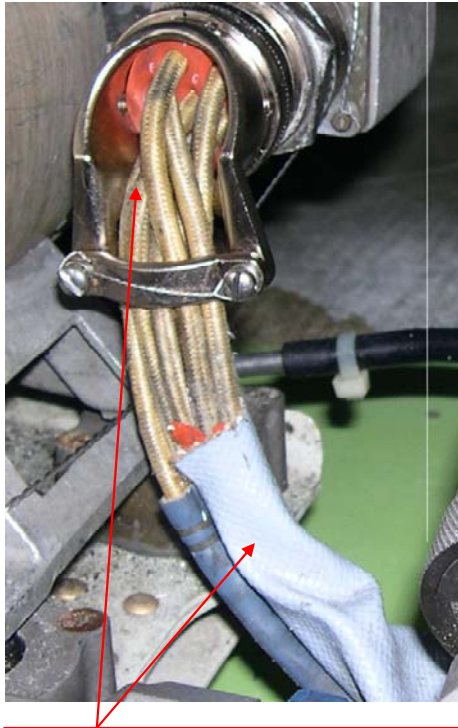

**Incorrect – No wrap on
Back shell of connector
and no tie tape**

**Correct – Wrap on
connector and tie tape**

Area 4

